


新一代智能缝纫机

THE NEW GENERATION OF INTELLIGENT SEWING MACHINE

HIKARI® 富山

零件手册

PARTS BOOK

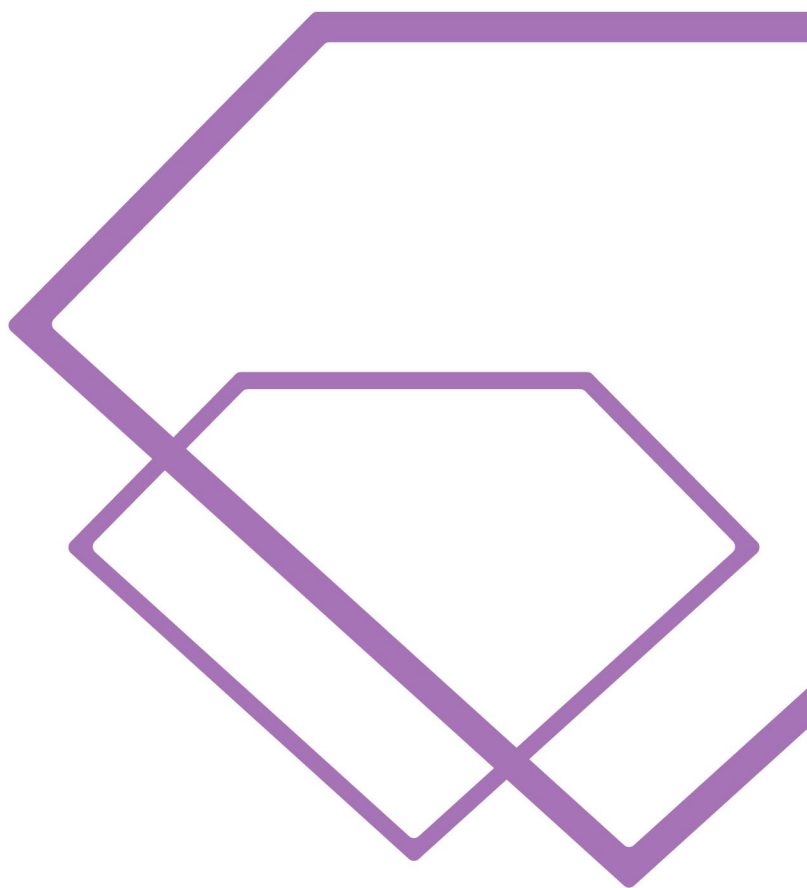

HSAT-K7C 系列
Series

三条杠专用压条机



THREE BAR SPECIALLY PRESSURE STRIP MACHINE

V1.00

目 录

1.台板组件.....	1
2.送料吹气.....	5
3.下切刀组件.....	7
4.显示屏与拉筒.....	9
5.上切刀组件.....	11
6.送带机组件.....	13
7.不锈钢罩壳组件.....	15
8.感应器与接头.....	17
9.电磁阀组件.....	19
10.针位零件一览.....	21
11.附件清单.....	27



1. 台板组件

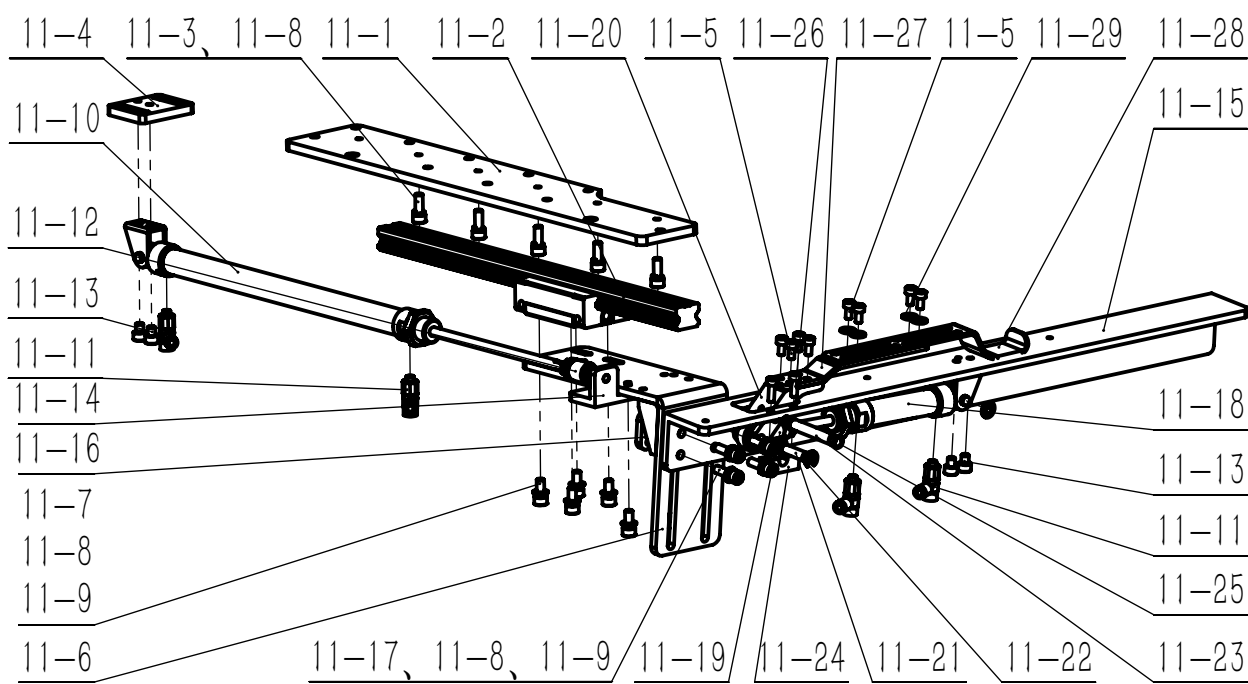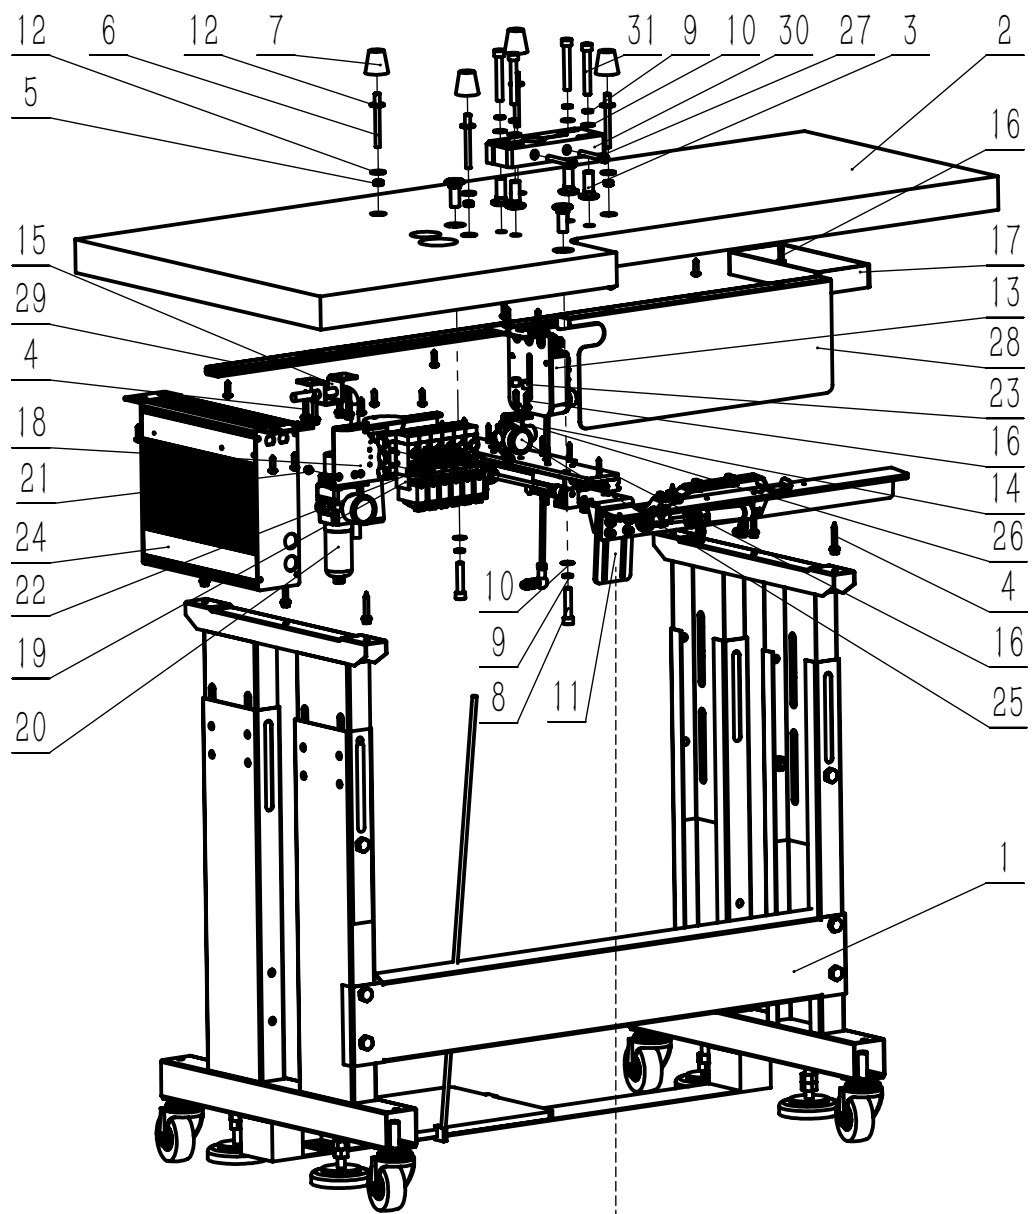

1. 台板组件

序号	SAP	图 号	名 称	NAME OF PARTS	数量
1	10003036	HI-CL	2mm站立升降双立柱+2.5寸轮脚单踏板+脚垫		1
2	30045202	524.07-02	台板		1
3	30001066	201.22-07-08-04	台板固定螺套		8
4	30109998	524.19-94	法兰十字外六角自攻螺钉M5×35		12
5	30005585	03-606000500-1	六角螺母M6×5		4
6	30000644	351.20-01	防震垫支撑销		4
7	30006276	331.20-01	底座避震垫		4
8	30037166	01-508004024-3	内六角圆柱头螺钉M8×40		2
9	30036189	07-0812121-6	弹簧垫圈8.1×2.1×2.1		6
10	30036253	05-085101400-3	平垫片8.5×1×14		6
11	20106217	524.19-44-00	K7A整体收料组件		1
11-1	30110195	524.24-11	收料安装板		1
11-2	30100245	524.11-09	收料导轨		1
11-3	30044611	01-505001424-3	内六角圆柱头螺钉M5×14		5
11-4	30110460	524.23-24	收料气缸安装板		1
11-5	30044581	01-504000824-3	内六角圆柱头螺钉M4×8		8
11-6	30106396	524.19-32	长收料安装架		1
11-7	30037154	01-505001224-3	内六角圆柱头螺钉M5×12		6
11-8	30033908	07-0521313-6	弹簧垫圈5.2×1.3×1.3		15
11-9	30036241	05-053101000-3	平垫片5.3×1.0×10.0		10
11-10	30059741	MAC16x200SCASDB	带缓冲气缸		1
11-11	30038908	AS1201F-M5-04A	自锁调速接头		4
11-12	30103019	F-M6x100F	浮动接头		1
11-13	30036136	01-505000624-3	内六角圆柱头螺钉M5×6		4
11-14	30106690	524.19-62	收料气缸连接块		1
11-15	30106403	524.19-35	收料杆		1
11-16	30106402	524.19-34	收料杆固定板		1
11-17	30104641	01-505001824-3	内六角圆柱头螺钉M5×18		4
11-18	30100308	MAC16×25SCASDB	带缓冲气缸		1
11-19	30100305	F-M6×100U	鱼眼接头		1
11-20	30106458	524.19-38	压布片固定块		1
11-21	30100252	524.11-30	固定轴		1
11-22	30005749	06-0500611-1	开口挡圈5×0.6×11		6
11-23	30100251	524.11-29	摆动销		1
11-24	30100253	524.11-32	摆动销固定块		1
11-25	30022574	12-060120	O型橡胶密封圈		2
11-26	30045212	01-504001224-3	内六角圆柱头螺钉M4×12		2
11-27	30106688	524.19-60	收料压布片安装架		1
11-28	30106689	524.19-61	收料压布片		1
11-29	30043999	05-042121000-3	平垫片4.2×1.2×10		4
12	30018266	05-064161800-1	平垫片6.4×1.6×18		4
13	30049959	KS-13N	调速器SP		1
14	30049960	KS-00N-01-A00	拉杆KS-00N		1
15	20004320	524.16-03	龙门砍刀膝控开关组件		1
16	30019274	21-3500192-4	十字槽半圆头木螺钉ST5.0×19.3		27
17	10000929	2111.32-52	配套抽屉		1


1. 台板组件

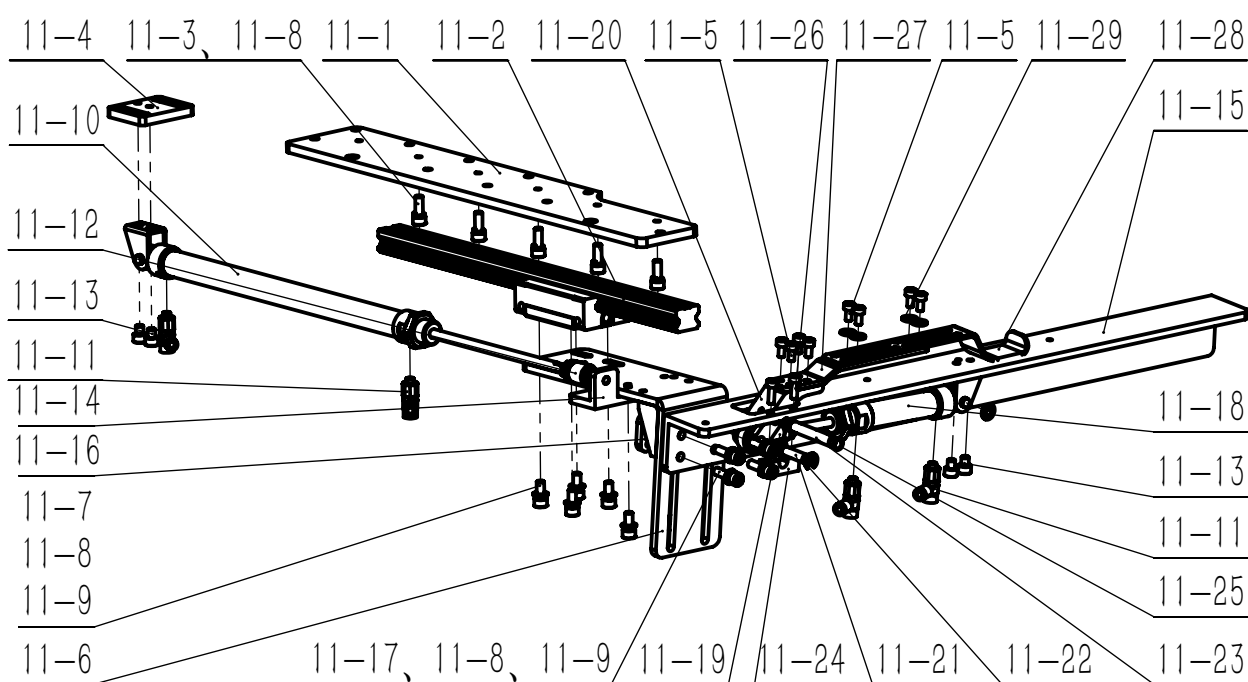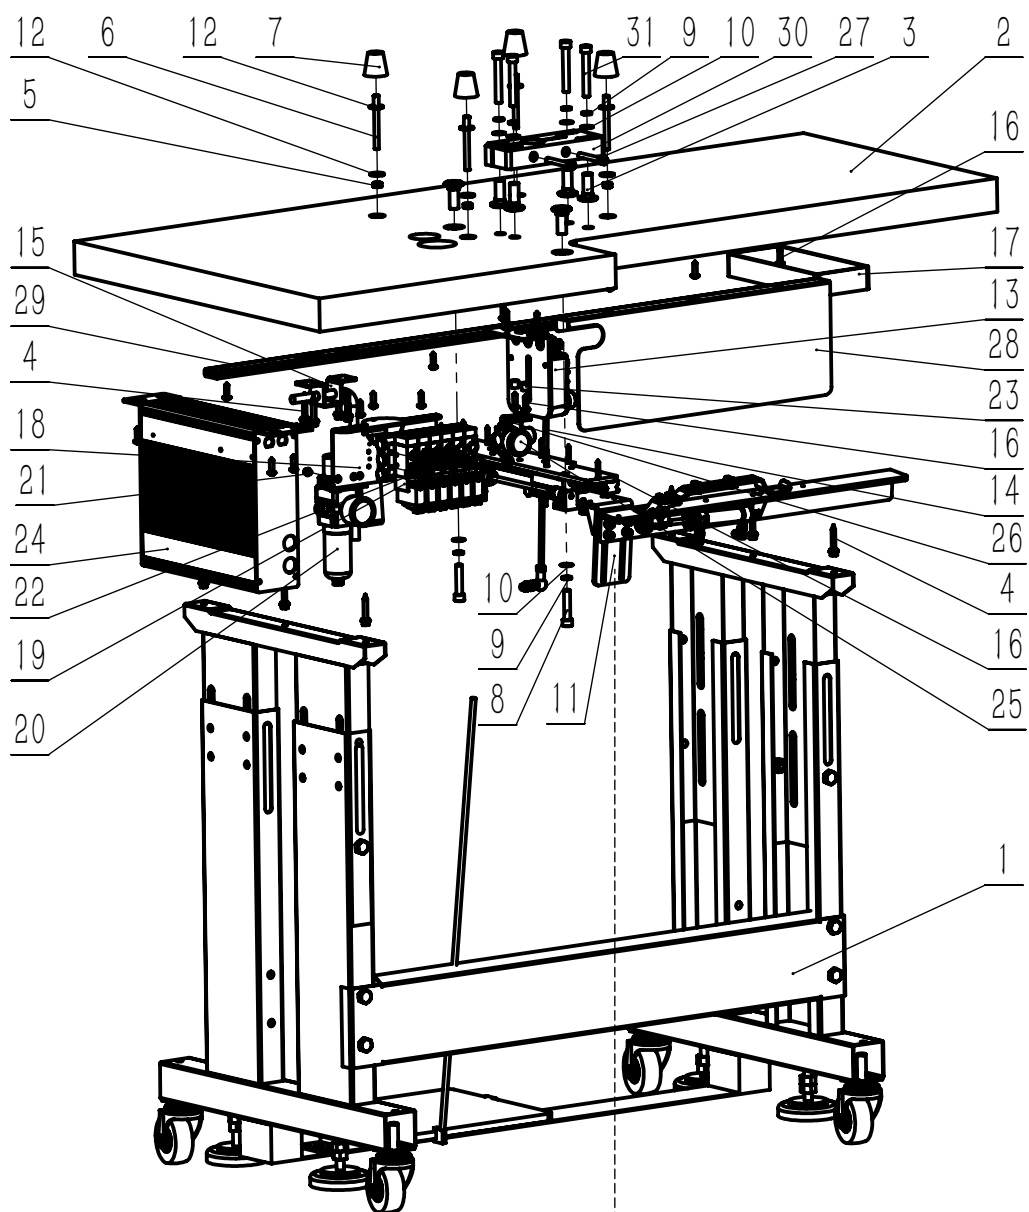

1. 台板组件

序号	SAP	图 号	名 称	NAME OF PARTS	数量
18	30041986	295.28-09	气控电磁阀支持板		1
19	20105768	524.07-51	电磁阀组件6阀		1
20	20002450	HX6800-12-10-01	气压表与分水滤气器		1
21	30006001	18-404000823-3	十字一字盘头三件套组合螺钉M4×8		2
22	30006008	18-404002823-3	十字一字盘头三件套组合螺钉M4×28		4
23	30057701	2111.32-42	隔套		2
24	20105769	CB10-02	阿迪滚条机专用电控组件		1
25	30039220	SDR100061	亚德客调压阀		1
26	30041532	PL401	L型螺纹二通管接头		2
27	30043227	01-506005024-6	内六角圆柱头螺钉M6×50		2
28	30105910	524.07-59	压料板		1
29	30108981	524.23-18	台板加强筋		1
30	30109606	524.23-20	送带机连接固定块		1
31	30037169	01-508006024-3	内六角圆柱头螺钉M8×60		4


2. 送料吹气

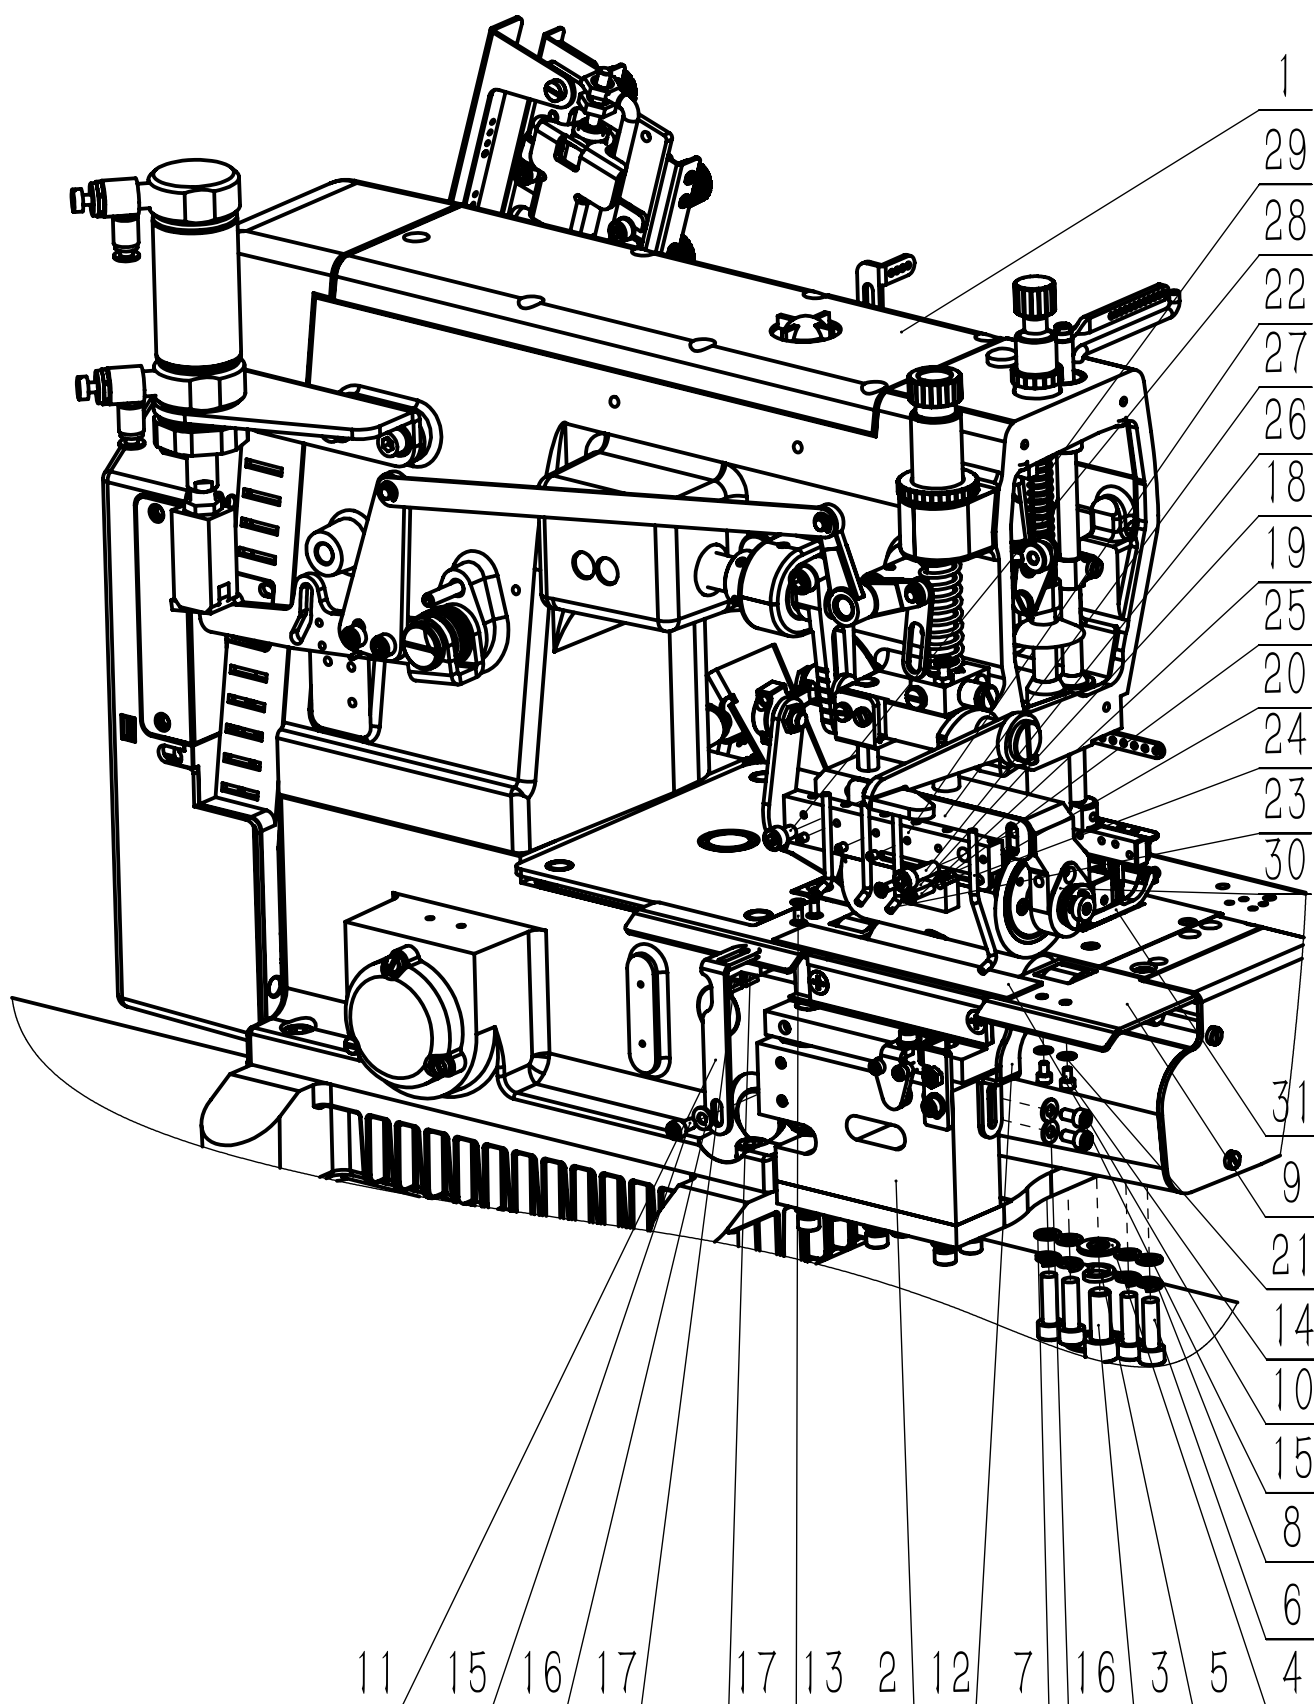

2. 送料吹气

序号	SAP	图 号	名 称	NAME OF PARTS	数量
1	10104514		K7A专用机头0711 7-11-7-11-7		1
2	20106213	524. 19-40-00	K7A下切刀组件		1
3	30034057	01-508002024-6	内六角圆柱头螺钉M8×20		1
4	30023303	05-081101553-5	平垫片8. 1×1. 0×15. 5		1
5	30036189	07-0812121-6	弹簧垫圈8. 1×2. 1×2. 1		1
6	30044616	01-506002024-3	内六角圆柱头螺钉M6×20		4
7	30005676	05-063101002-1	平垫片6. 3×1. 0×10		4
8	30036188	07-0631616-6	弹簧垫圈6. 3×1. 6×1. 6		4
9	30108973	524. 23-12	下切刀盖板		1
10	30043694	REF-IRF-56	反光膜		2
11	30108976	524. 23-13	切刀盖板支撑架1		1
12	30108977	524. 23-14	切刀盖板支撑架2		1
13	30005039	01-103000821-1	一字槽沉头螺钉M3×8		2
14	30044601	01-503000524-3	内六角圆柱头螺钉M3×5		2
15	30044581	01-504000824-3	内六角圆柱头螺钉M4×8		5
16	30005629	05-043080900-3	平垫片4. 3×0. 8×9		5
17	30110068	03-403000200-4	方形螺母 外形8×8		2
18	30047119	GL2S-E1311/SICK	迷你镜面反射传感器		2
19	30005047	01-103001422-3	十字槽沉头螺钉M3×14		4
20	30005547	03-603000240-3	六角螺母M3×2. 4		6
21	30005614	05-032050700-3	平垫片3. 2×0. 5×7		6
22	30108964	524. 23-06	送料吹气固定块		1
23	30108965	524. 23-07	送料吹气管		3
24	30108979	524. 23-16	送料吹气管2		1
25	30022647	01-503000511-1	一字槽圆柱头凹端紧定螺钉M3×5		5
26	30037155	01-505001624-3	内六角圆柱头螺钉M5×16		1
27	30108978	524. 23-15	上拖轮挡料板		1
28	30020159	01-605001121-1	一字槽圆柱头大薄帽螺钉M5×11		1
29	30007347	331. 08-15	压杆簧		1
30	20106329	524. 19-39	平拖轮组件		1
31	30102805	524. 15-10	压脚组件7-11-7-11-7		1


3. 下切刀组件

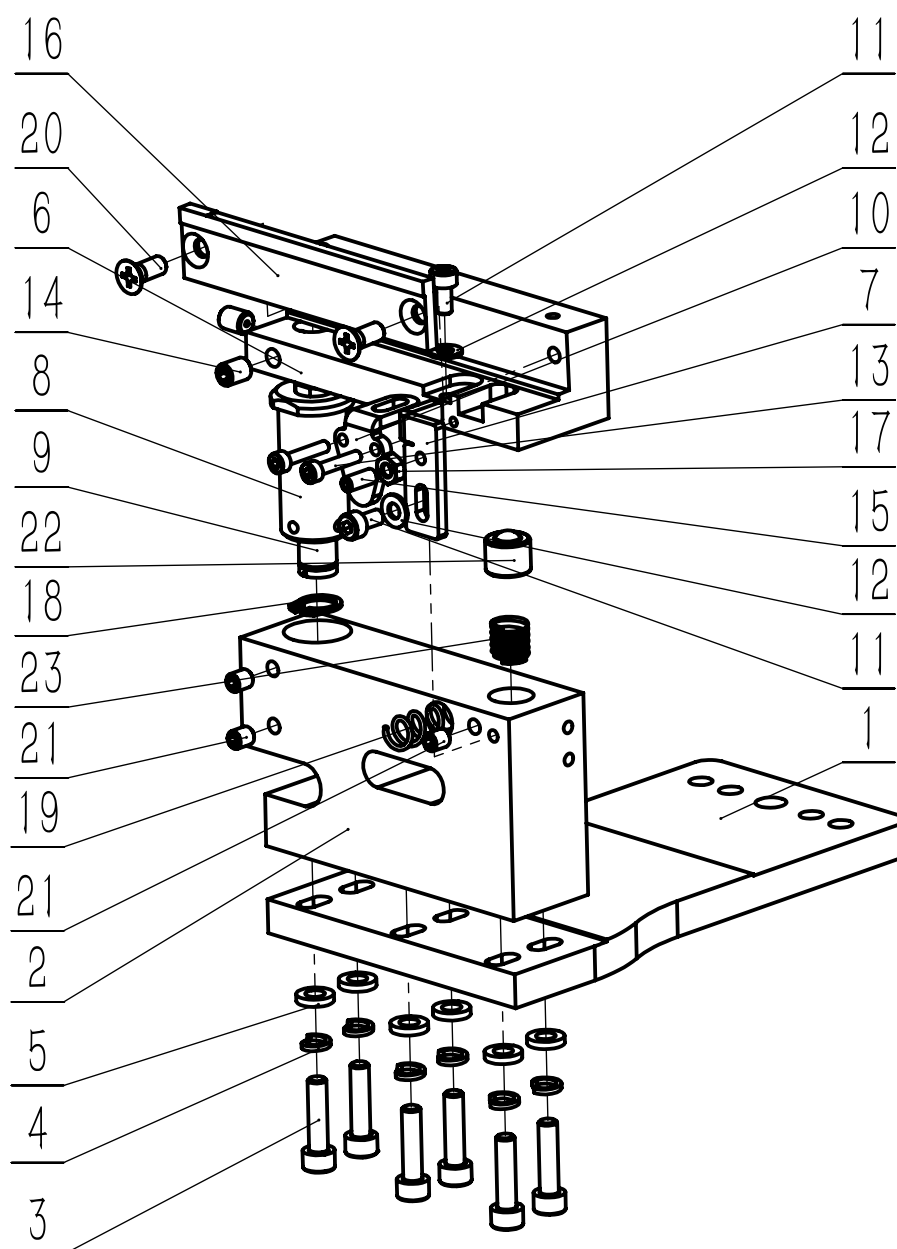

3. 下切刀组件

序号	SAP	图 号	名 称	NAME OF PARTS	数量
1	30106371	524. 19-13	下切刀安装板		1
2	30106372	524. 19-14	下切刀安装座		1
3	30037153	01-505002024-3	内六角圆柱头螺钉M5×20		6
4	30033908	07-0521313-6	弹簧垫圈5. 2×1. 3×1. 3		6
5	30058454	05-053201000-3	平垫片5. 3×2×10		6
6	30106373	524. 19-15	定刀座		1
7	30106374	524. 19-16	定刀调整件1		1
8	30050820	524. 07-10	旋转轴套		1
9	30050821	524. 07-11	旋转轴		1
10	30106375	524. 19-17	定刀调整件2		1
11	30044581	01-504000824-3	内六角圆柱头螺钉M4×8		2
12	30005629	05-043080900-3	平垫片4. 3×0. 8×9		2
13	30048828	01-503001624-3	内六角圆柱头螺钉M3×16		2
14	30005337	01-806000814-1	内六角凹端紧定螺钉M6×8		2
15	30005308	01-804001014-1	内六角凹端紧定螺钉M4×10		1
16	30045235	524. 07-25	定刀		1
17	30005555	03-604000320-1	六角螺母M4×3. 2		1
18	30005795	10-0931015-1	轴用弹性挡圈9. 3×1×1. 5		1
19	30106798	524. 19-66	压簧1. 2x9x30		1
20	30037203	01-105001222-3	十字槽沉头螺钉M5×12		2
21	30005316	01-805000614-1	内六角凹端紧定螺钉M5×6		2
22	30027259	14-KSM-8	单眼万向球KSM-8		1
23	30110069	524. 24-03	压簧0. 6×10×10		1


4. 显示屏与拉筒

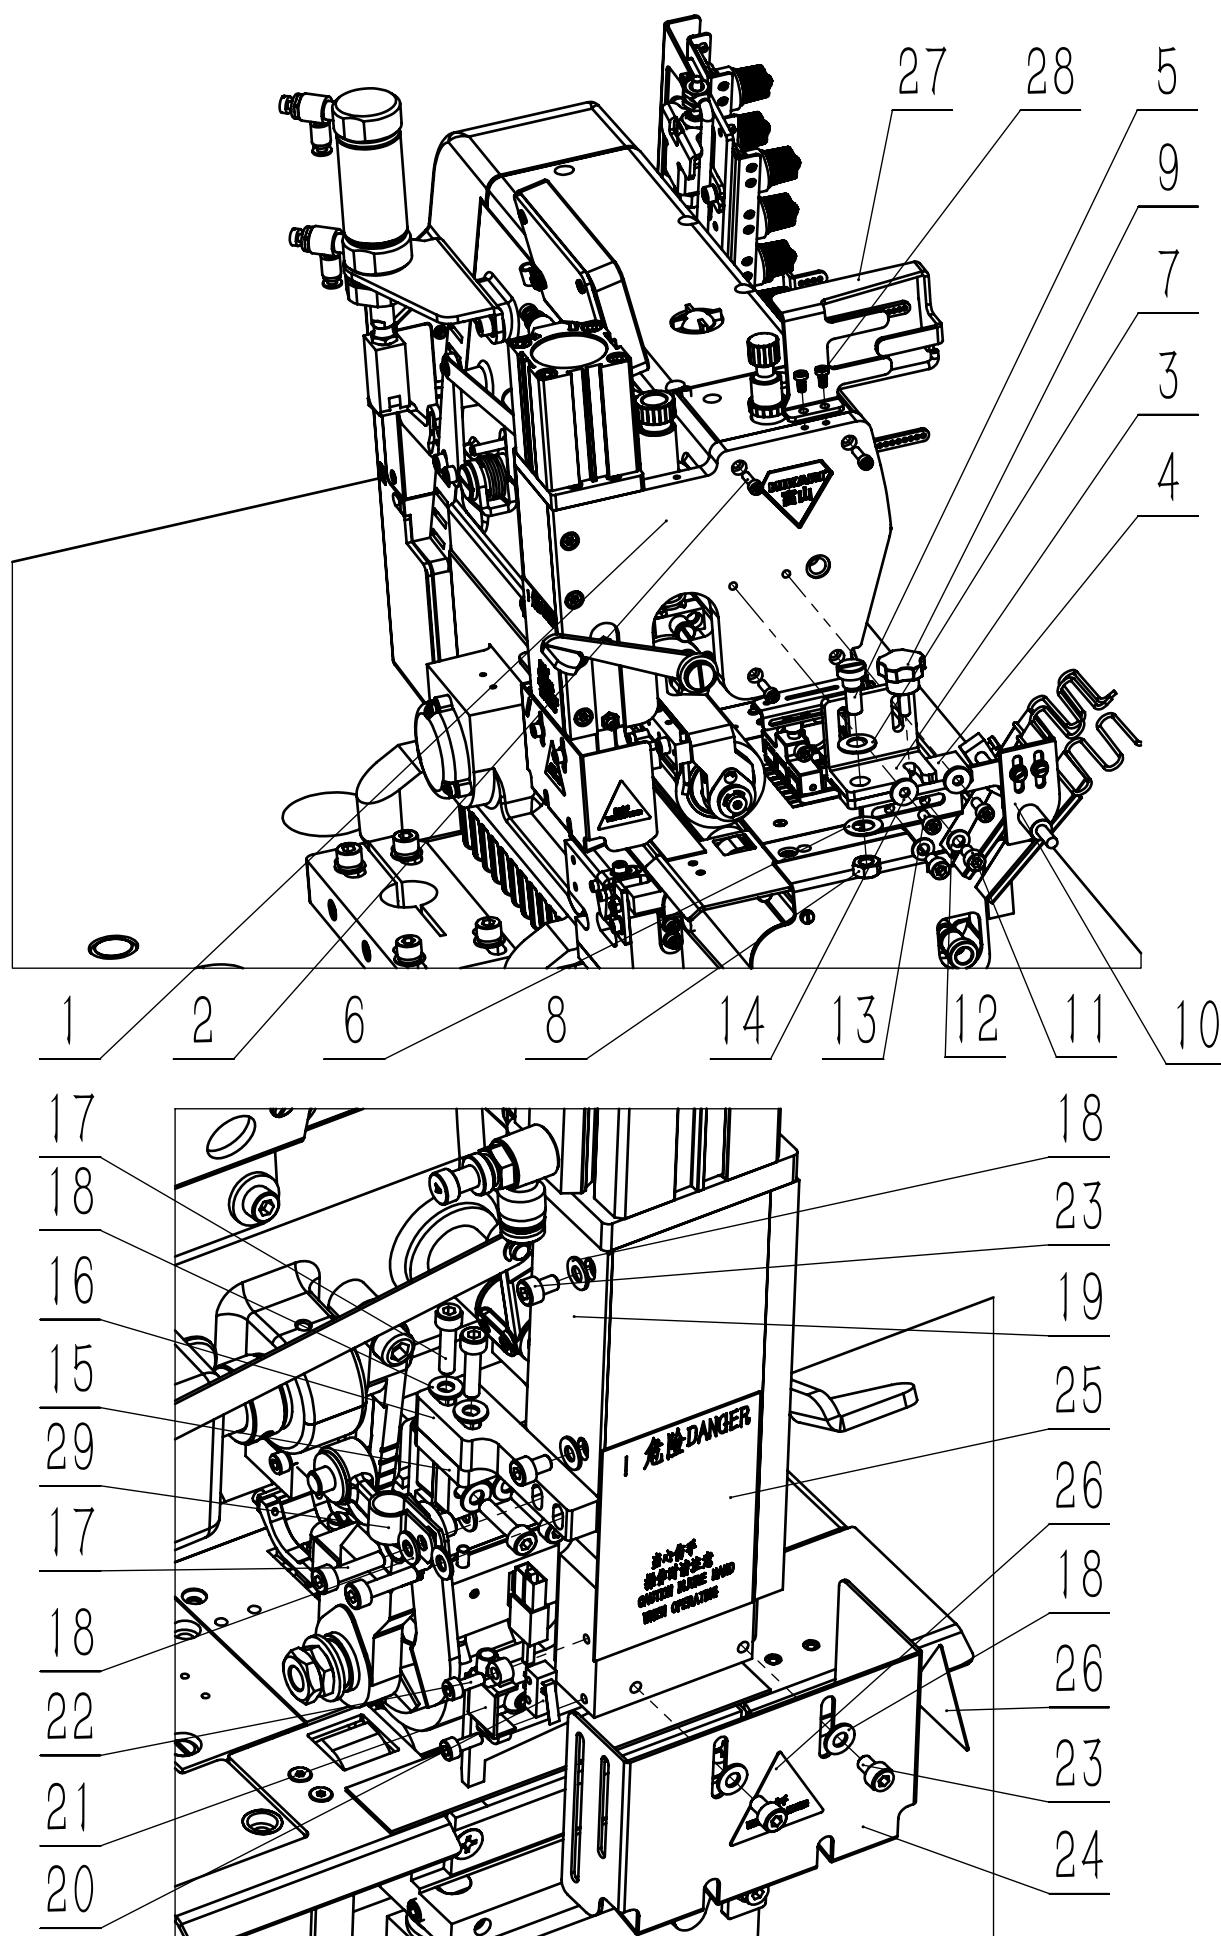

4. 显示屏与拉筒

序号	SAP	图 号	名 称	NAME OF PARTS	数量
1	20106214	524. 19-41-00	K7A上切刀组件		1
2	30044606	01-504001424-3	内六角圆柱头螺钉M4×14		4
3	30102802	524. 06-105	拉筒安装架1		1
4	30102803	524. 06-106	拉筒安装架2		1
5	30045410	2111. 30-77	轴位螺钉		1
6	30005726	05-105091800-1	平垫片10. 5×0. 9×18		2
7	30005790	09-1021020-1	碟形垫圈10. 2×1×20		1
8	30025896	03-608000650-1	六角螺母M8×6. 5		2
9	30045774	515. 30-10	星型旋钮M5×16		1
10	30045233	524. 06-100	多针机贴条筒		1
11	30044615	01-506001024-3	内六角圆柱头螺钉M6×10		2
12	30036198	05-064161200-6	平垫片6. 4×1. 6×12		2
13	30037154	01-505001224-3	内六角圆柱头螺钉M5×12		4
14	30100528	05-053201450-3	平垫片5. 3×2×14. 5		6
15	30106367	524. 19-09	动刀座支撑块1		1
16	30106368	524. 19-10	动刀座支撑块2		1
17	30036230	01-504001624-3	内六角圆柱头螺钉M4×16		6
18	30005629	05-043080900-3	平垫片4. 3×0. 8×9		12
19	30106369	524. 19-11	动刀座盖板1		1
20	30050582	210. 27-28-00	手动剪线开关组件（TD）		1
21	30002369	210. 27-07	安全开关外罩		1
22	30044602	01-503000824-3	内六角圆柱头螺钉M3×8		2
23	30044604	01-504000624-3	内六角圆柱头螺钉M4×6		4
24	30108980	524. 23-17	动刀防护罩		1
25	30108431	524. 19-92	当心伤手方形贴纸		1
26	30108432	524. 19-93	当心伤手三角贴纸		2
27	30051020	331. 01-04A	挑线杆护罩		1
28	30005152	01-504000821-1	一字槽圆柱头螺钉M4×8		2
29	30008258	331. 18-22	气路管夹(中)		1


5. 上切刀组件

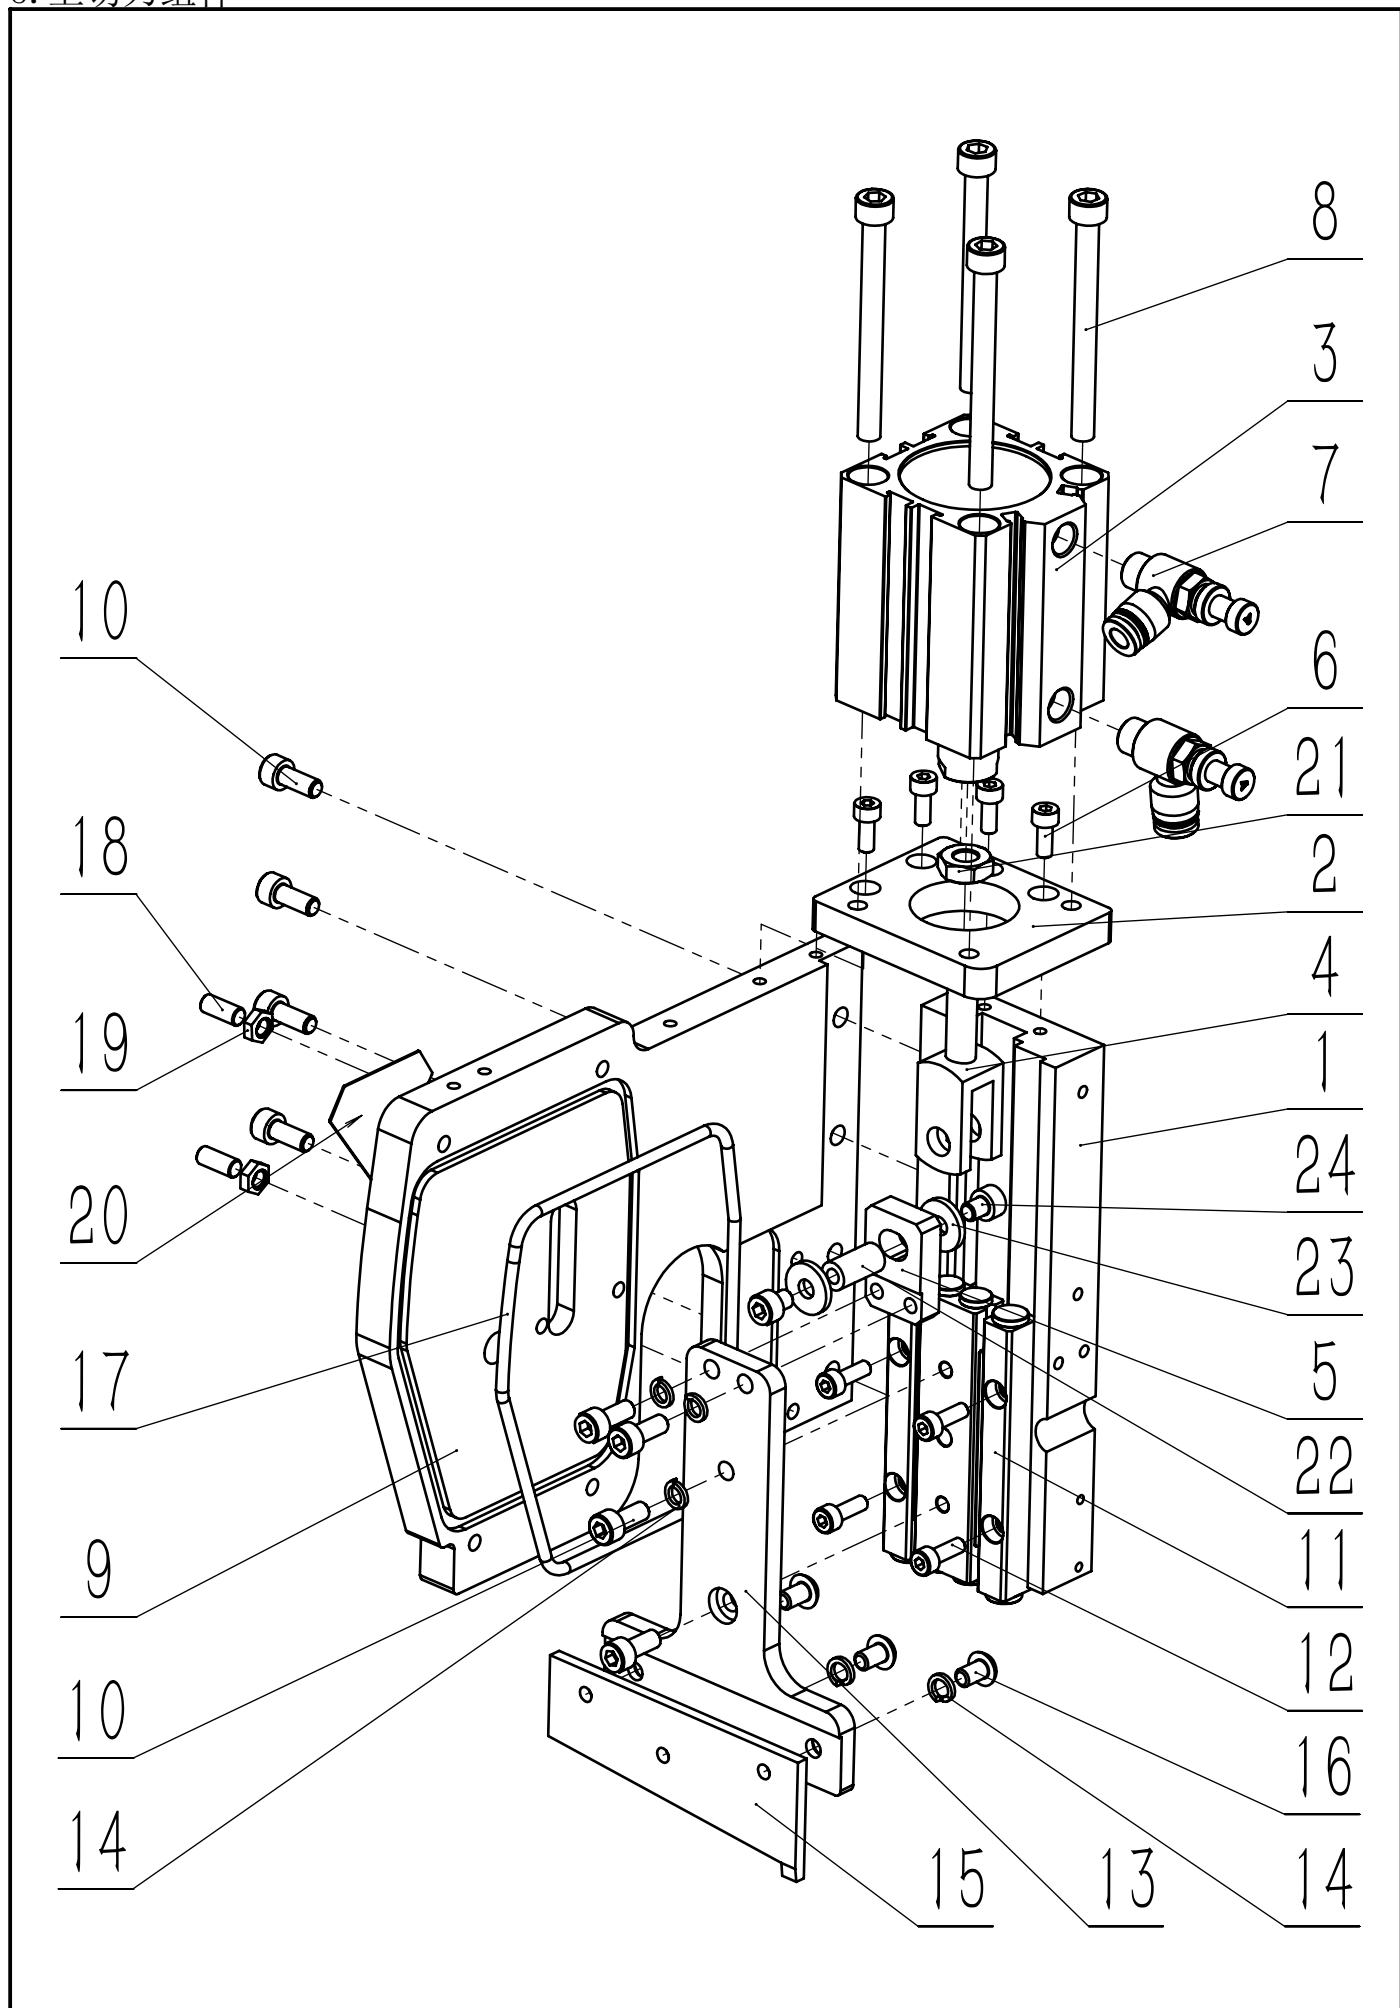

5. 上切刀组件

序号	SAP	图 号	名 称	NAME OF PARTS	数量
1	30106360	524. 19-02	动刀滑块座		1
2	30106361	524. 19-03	动刀气缸安装板		1
3	30045227	SDA40×40	超薄气缸		1
4	30106362	524. 19-04	Y型接头外螺纹		1
5	30106363	524. 19-05	气缸连接板		1
6	30044605	01-504001024-3	内六角圆柱头螺钉M4×10		4
7	30042191	PTL601A	调速阀		2
8	30044583	01-506006524-3	内六角圆柱头螺钉M6×65		4
9	30106359	524. 19-01	动刀座安装固定板		1
10	30037154	01-505001224-3	内六角圆柱头螺钉M5×12		8
11	30047344	LGC4A80R8-H	微型导轨（亚德客）		1
12	30045212	01-504001224-3	内六角圆柱头螺钉M4×12		4
13	30106364	524. 19-06	动刀安装连接板		1
14	30033908	07-0521313-6	弹簧垫圈5. 2×1. 3×1. 3		6
15	30106365	524. 19-07	动刀		1
16	30037184	01-305000824-3	内六角平圆头螺钉M5×8		3
17	30006262	331. 01-05	油封		1
18	30034479	01-805001224-6	内六角平端紧定螺钉M5×12		2
19	30005564	03-605000370-6	六角螺母M5×3. 7		2
20	30100850	H0-009	面板贴钻石型（大）		1
21	30036185	03-608000500-3	六角螺母M8×5		1
22	30110067	524. 24-02	上切刀接头销轴		1
23	30100528	05-053201450-3	平垫片5. 3×2×14. 5		2
24	30036136	01-505000624-3	内六角圆柱头螺钉M5×6		2


6. 送带机组件

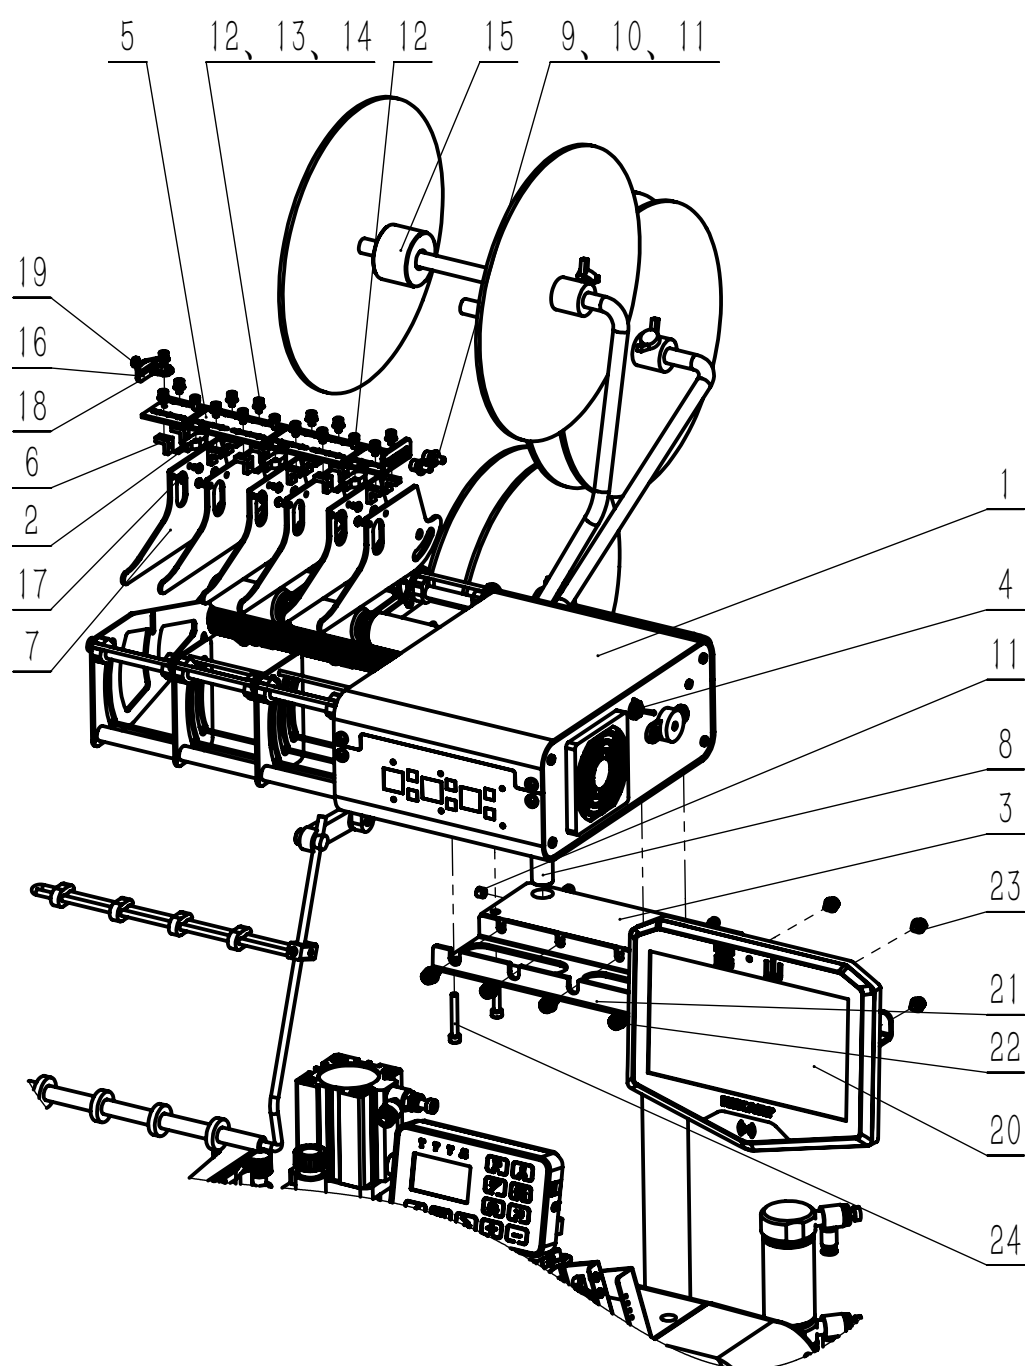

6. 送带机组件

序号	SAP	图 号	名 称	NAME OF PARTS	数量
1	30108591	TFU16-3AD	三条杠送带机铁丝启动		1
2	30108939	524. 19-89	缝纫机布料感应传感器		3
3	30110125	524. 24-07	三彩送带安装架		1
4	30110045	X-KD-42	送带感应器与开关连接线		1
5	30110127	524. 24-09	无接触感应安装架		1
6	30110124	524. 24-06	角码连接件		12
7	30110126	524. 24-08	送带机挡板		6
8	30110401	524. 24-12	送带机固定轴		1
9	30044605	01-504001024-3	内六角圆柱头螺钉M4×10		2
10	30036187	07-0421111-6	弹簧垫圈4. 2×1. 1×1. 1		2
11	30043999	05-042121000-3	平垫片4. 2×1. 2×10		2
12	30044580	01-503000624-3	内六角圆柱头螺钉M3×6		16
13	30036191	07-0310808-3	弹簧垫圈3. 1×0. 8×0. 8		13
14	30005614	05-032050700-3	平垫片3. 2×0. 5×7		13
15	30052987	524. 07-17	隔圈		3
16	30110123	524. 24-05	辅助支撑架1		1
17	30049028	01-303000424-3	内六角平圆头螺钉M3×4		12
18	30104645	01-303000824-3	内六角平圆头螺钉M3×8		1
19	30005547	03-603000240-3	六角螺母M3×2. 4		1
20	30102874		工业智能屏		1
21	30110129	524. 24-10	钻石屏安装架		1
22	30006010	18-405001023-3	十字一字盘头三件套组合螺钉M5×10		4
23	30006001	18-404000823-3	十字一字盘头三件套组合螺钉M4×8		4
24	30044582	01-504003024-3	内六角圆柱头螺钉M4×30		4



7. 不锈钢罩壳组件

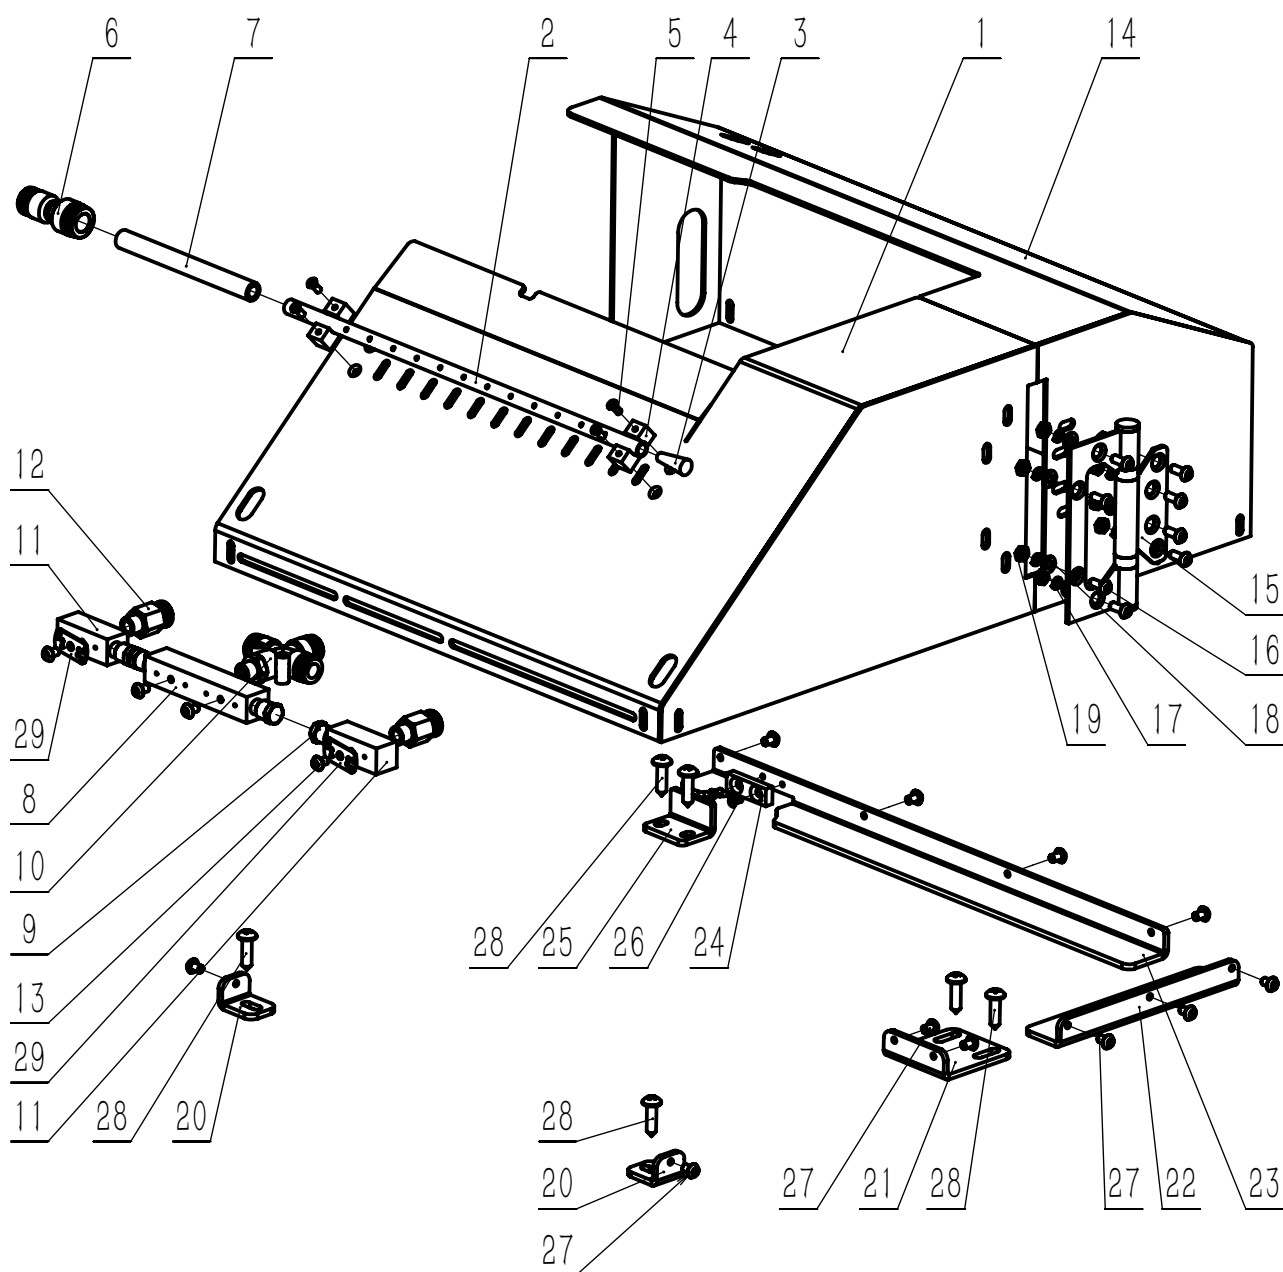

7. 不锈钢罩壳组件

序号	SAP	图 号	名 称	NAME OF PARTS	数量
1	30108928	524. 19-87	平台左罩壳		1
2	30105967	524. 07-61	收料吹气管		1
3	30106687	524. 19-59	橡胶堵头M8		1
4	30100341	524. 07-27	吹气管固定块		2
5	30005040	01-103000822-3	十字槽沉头螺钉M3×8		4
6	30045325	PG10-8	直通接头		1
7	30021028		【气管】10*6. 5(1EA=1M)		0. 2
8	30105908	524. 07-57	收料吹气座1		1
9	30051906	BZ01	外六角堵头		4
10	30105913	PZB801	十字螺纹四通		1
11	30105909	524. 07-58	收料吹气座2		2
12	30052249	BPC801	管接头		2
13	30036125	01-304000624-3	内六角平圆头螺钉M4×6		4
14	30108933	524. 19-88	平台右罩壳		1
15	30108160	524. 22-21	4寸子母合页		1
16	30036130	01-304001024-3	内六角平圆头螺钉M4×10		8
17	30036187	07-0421111-6	弹簧垫圈4. 2×1. 1×1. 1		8
18	30005629	05-043080900-3	平垫片4. 3×0. 8×9		8
19	30036178	03-604000300-6	六角螺母M4×3		8
20	30102894	524. 07-44	罩壳固定块1		2
21	30102895	524. 07-45	罩壳固定块2		1
22	30102896	524. 07-46	罩壳固定块3		1
23	30102897	524. 07-47	罩壳固定块4		1
24	30052303		双孔磁铁30×10×5		1
25	30102898	524. 07-48	磁铁安装块		1
26	30102652	01-103000624-3	内六角沉头螺钉M3×6		2
27	30044604	01-504000624-3	内六角圆柱头螺钉M4×6		11
28	30019274	21-35001932-4	十字槽半圆头木螺钉ST5. 0×19. 3		6
29	30110070	524. 24-04	收料吹气调节片		2


8. 感应器与接头

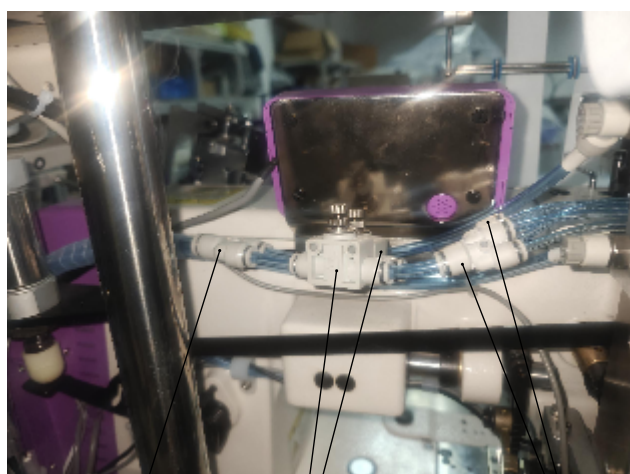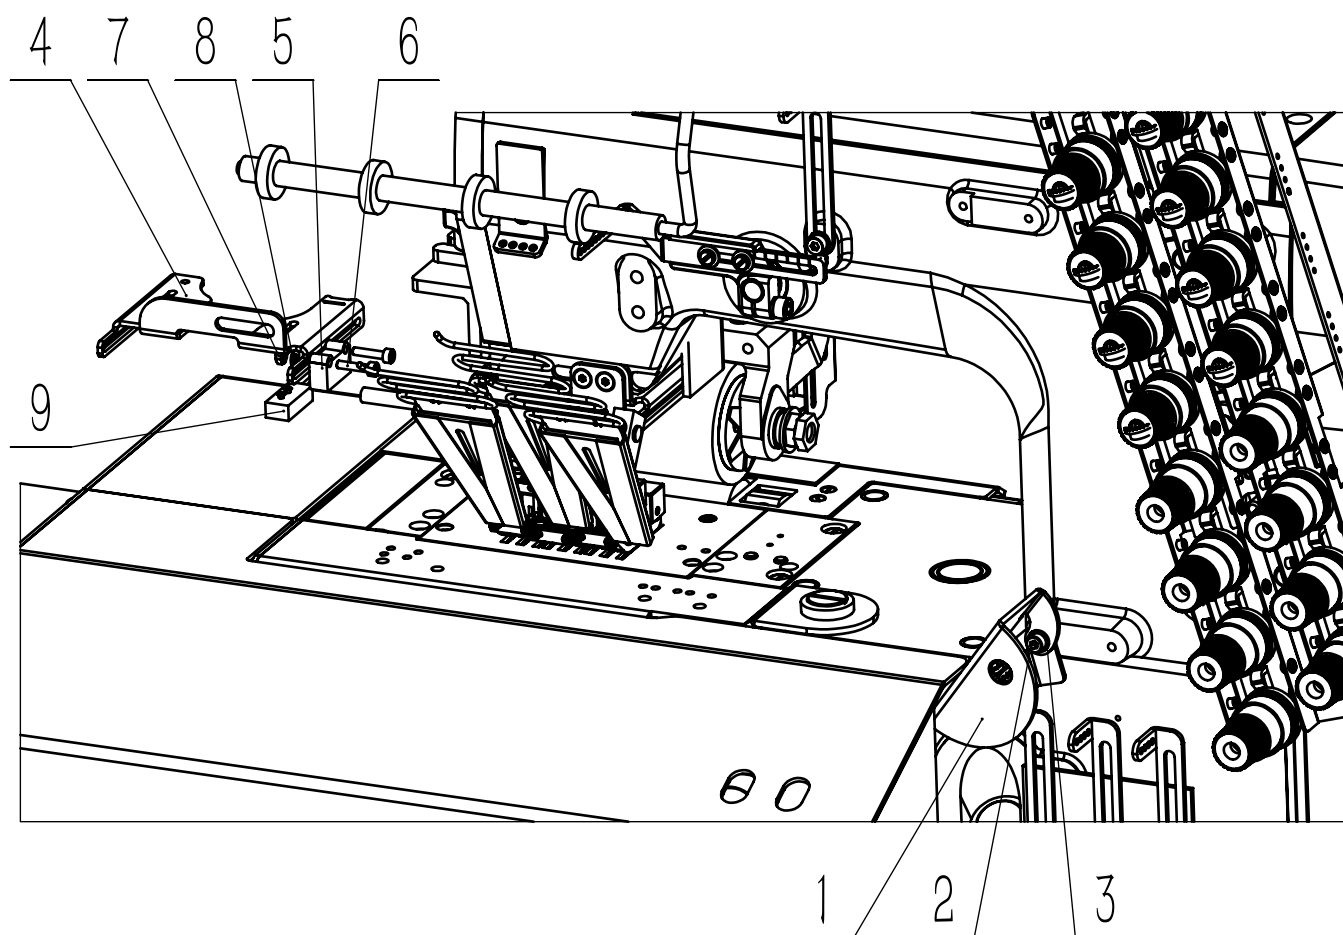

8. 感应器与接头

序号	SAP	图 号	名 称	NAME OF PARTS	数量
1	30050828	524. 07-16	护片		1
2	30044581	01-504000824-3	内六角圆柱头螺钉M4×8		5
3	30005629	05-043080900-3	平垫片4. 3×0. 8×9		5
4	30107980	524. 19-77	前感应器安装架		1
5	30047119	GL2S-E1311/SICK	迷你镜面反射传感器		1
6	30005047	01-103001422-3	十字槽沉头螺钉M3×14		2
7	30005547	03-603000240-3	六角螺母M3×2. 4		2
8	30005614	05-032050700-3	平垫片3. 2×0. 5×7		2
9	30050534	JL10-06-A00A	机头灯组件		1
10	30038910	PSA6	调速阀		1
11	30045125	PYW8-6	管接头		1
12	30045124	PYW6-4	管接头		2
13	30041913	PSA8	调速阀		2


9. 电磁阀组件

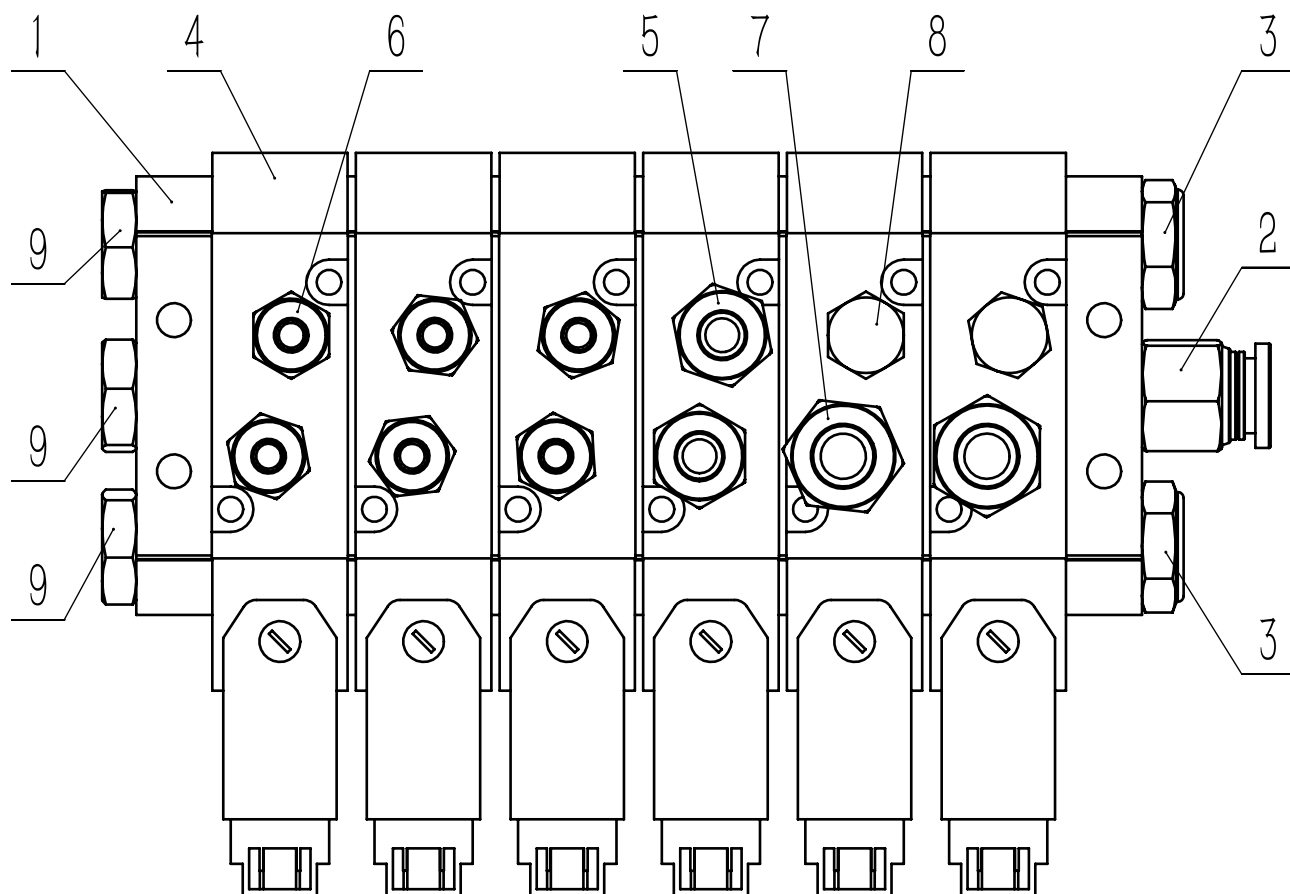

9. 电磁阀组件

序号	SAP	图 号	名 称	NAME OF PARTS	数量
1	30044314	100M6F	电磁阀底座		1
2	30038914	BPC802	管接头		1
3	30041535	BSLM02	消声器		2
4	30041531	5V11006B	电磁阀		6
5	30038913	BPC601	管接头		2
6	30038912	BPC401	管接头		6
7	30052249	BPC801	管接头		2
8	30051906	BZ01	外六角堵头		2
9	30041536	BZ02	外六角堵头		3


10. 针位零件一览

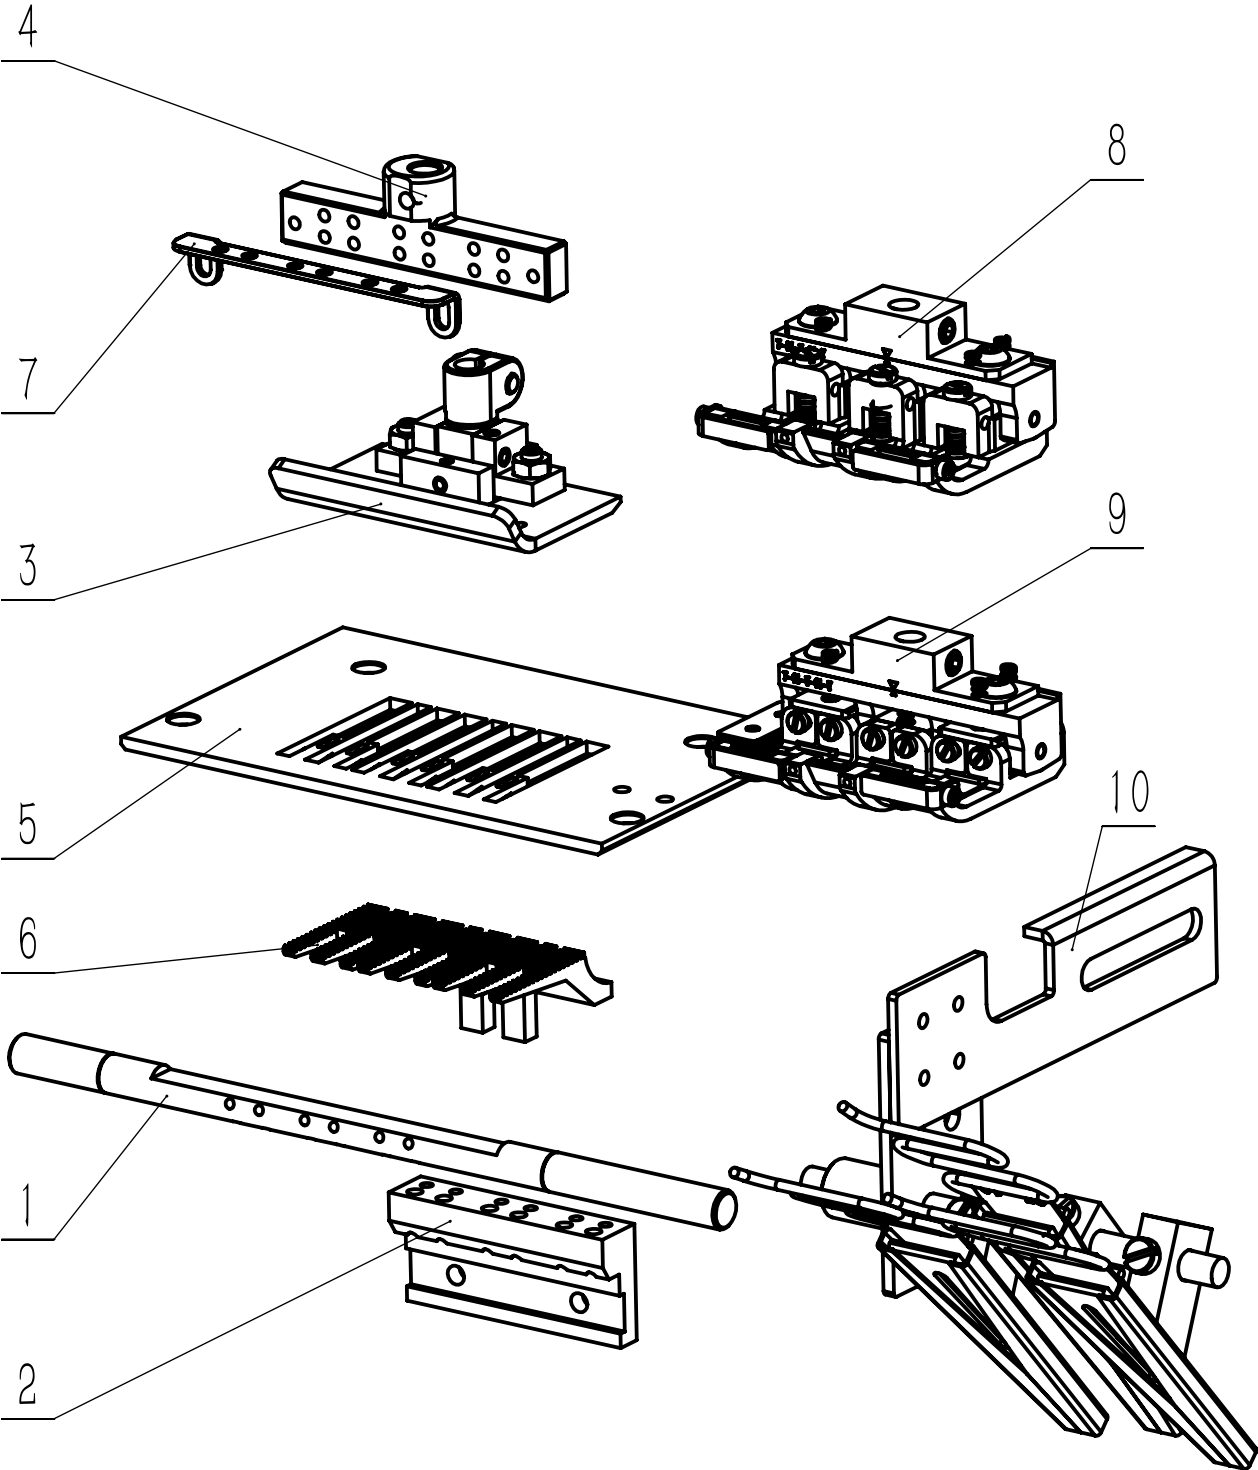

10. 针位零件一览

序号	SAP	图 号	名 称	NAME OF PARTS	数量
1-1	30033104	336. 21-01-01	拨线杆7-11-7-11-7		1
1-2	30033107	336. 21-01-03	弯针座7-11-7-11-7		1
1-3	30033113	336. 21-01-04	压脚组件7-11-7-11-7		1
1-4	30033101	336. 21-01-05	针夹7-11-7-11-7		1
1-5	30033110	336. 21-01-07	针板7-11-7-11-7		1
1-6	30033116	336. 21-01-08	送料牙7-11-7-11-7		1
1-7	30033942	336. 21-01-09	导线板7-11-7-11-7		1
1-8	30107482	524. 20-01-01	压脚组件7-11-7-11-7		1
1-9	30108292	524. 20-01-11	压脚组件7-11-7-11-7		1
1-10	30045233	524. 06-100	多针机贴条筒进25出10		1
2-1	30042736	336. 21-10-01	拨线杆7-12-7-12-7		1
2-2	30042734	336. 21-10-03	弯针座7-12-7-12-7		1
2-3	30042732	336. 21-10-04	压脚组件7-12-7-12-7		1
2-4	30042730	336. 21-10-05	针夹7-12-7-12-7		1
2-5	30042731	336. 21-10-07	针板7-12-7-12-7		1
2-6	30042735	336. 21-10-08	送料牙7-12-7-12-7		1
2-7	30042737	336. 21-10-09	导线板7-12-7-12-7		1
2-8	30109365	524. 20-10-01	压脚组件7-12-7-12-7		1
2-9	30109385	524. 20-10-11	压脚组件7-12-7-12-7		1
2-10	30045233	524. 06-100	多针机贴条筒进25出10		1
3-1	30106921	336. 21-04-01	拨线杆9-9-9-9-9		1
3-2	30106922	336. 21-04-03	弯针座9-9-9-9-9		1
3-3	30106928	336. 21-04-04	压脚组件9-9-9-9-9		1
3-4	30106923	336. 21-04-05	针夹9-9-9-9-9		1
3-5	30106924	336. 21-04-07	针板9-9-9-9-9		1
3-6	30106925	336. 21-04-08	送料牙9-9-9-9-9		1
3-7	30106926	336. 21-04-09	导线板9-9-9-9-9		1
3-8	30109401	524. 20-04-10	压脚组件9-9-9-9-9		1
3-9	30109412	524. 20-04-11	压脚组件9-9-9-9-9		1
3-10	30107001	524. 20-04-02	三条杠贴条筒进28出12		1


10. 针位零件一览

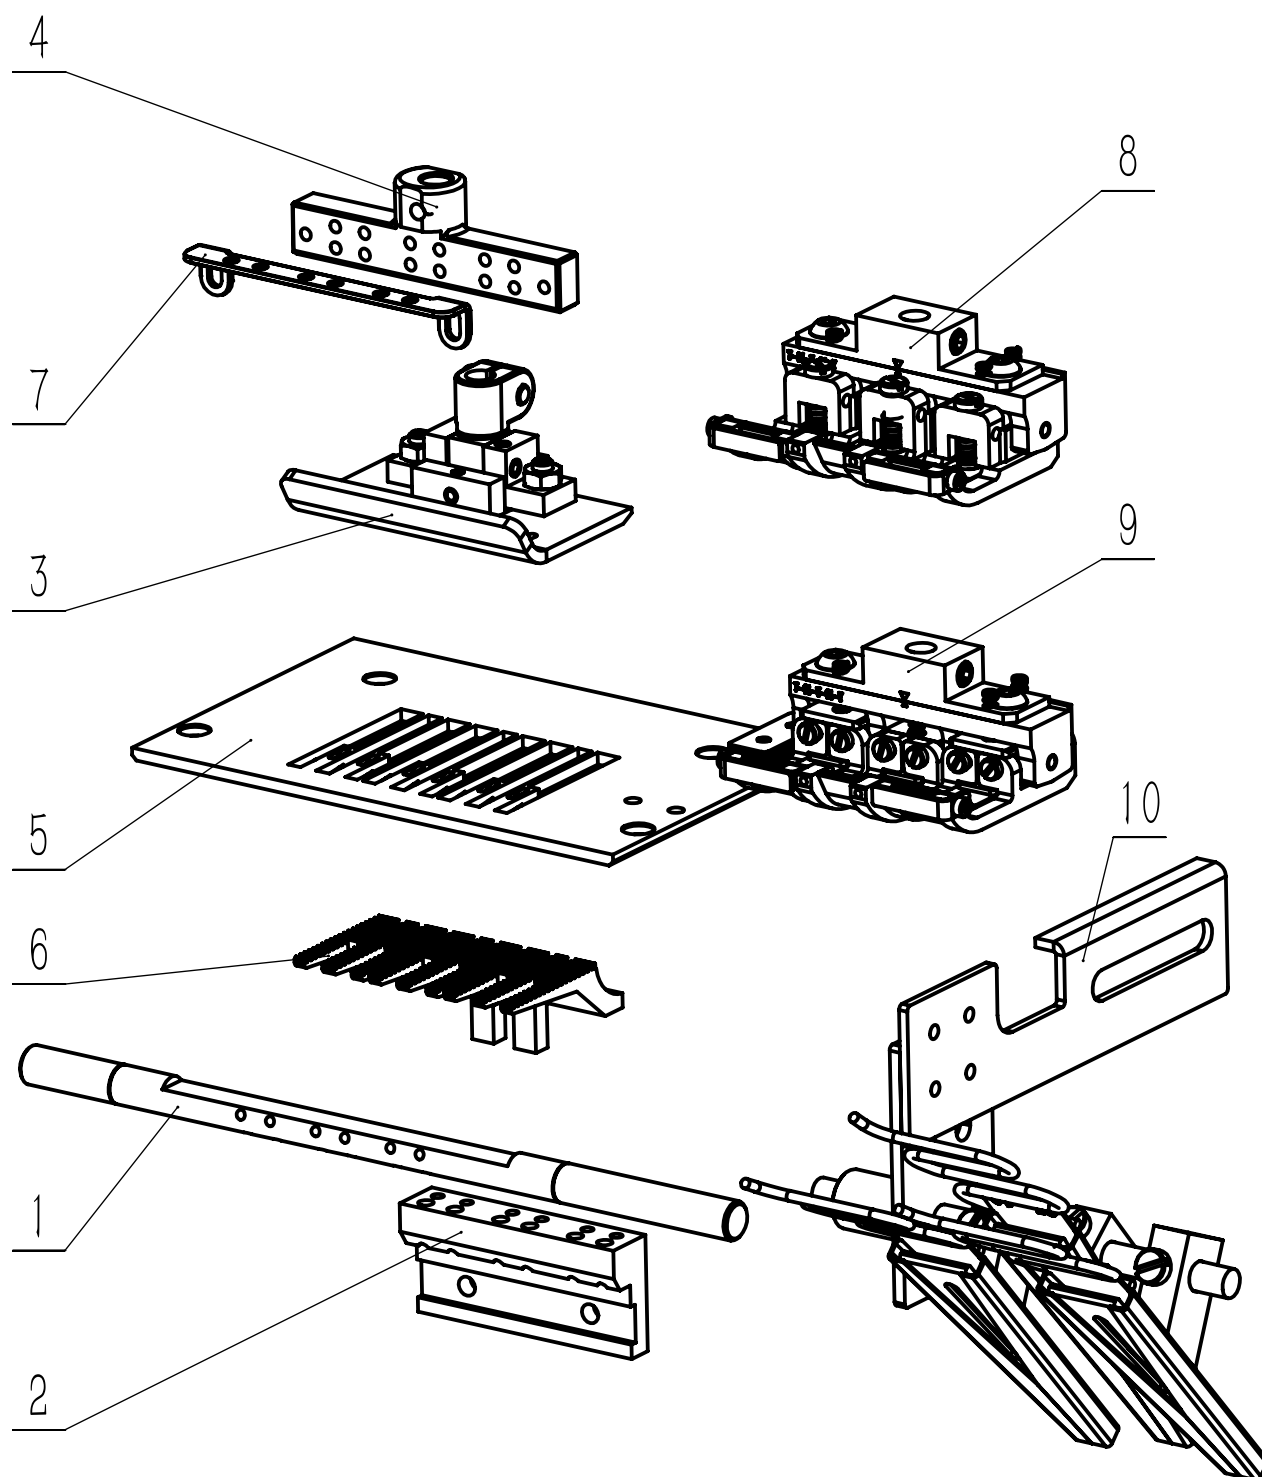

10. 针位零件一览

序号	SAP	图 号	名 称	NAME OF PARTS	数量
4-1	30106909	336. 21-05-01	拨线杆11-10-11-10-11		1
4-2	30106910	336. 21-05-03	弯针座11-10-11-10-11		1
4-3	30106917	336. 21-05-04	压脚组件11-10-11-10-11		1
4-4	30106912	336. 21-05-05	针夹11-10-11-10-11		1
4-5	30106913	336. 21-05-07	针板11-10-11-10-11		1
4-6	30106914	336. 21-05-08	送料牙11-10-11-10-11		1
4-7	30106915	336. 21-05-09	导线板11-10-11-10-11		1
4-8	30109114	524. 20-05-10	压脚组件11-10-11-10-11		1
4-9	30109125	524. 20-05-11	压脚组件11-10-11-10-11		1
4-10	30107004	524. 20-05-02	三条杠贴条筒进32出14		1
5-1	30104133	336. 21-03-01	拨线杆13-11-13-11-13		1
5-2	30104135	336. 21-03-03	弯针座13-11-13-11-13		1
5-3	30104137	336. 21-03-04	压脚组件13-11-13-11-13		1
5-4	30104139	336. 21-03-05	针夹13-11-13-11-13		1
5-5	30104141	336. 21-03-07	针板13-11-13-11-13		1
5-6	30104142	336. 21-03-08	送料牙13-11-13-11-13		1
5-7	30104264	336. 21-03-09	导线板13-11-13-11-13		1
5-8	30108660	524. 20-03-01	压脚组件13-11-13-11-13		1
5-9	30108661	524. 20-03-11	压脚组件13-11-13-11-13		1
5-10	30104431	524. 06-109	贴条筒进34出16		1
6-1	30108889	336. 21-09-01	拨线杆14. 5-11-14. 5-11-14. 5		1
6-2	30108890	336. 21-09-03	弯针座14. 5-11-14. 5-11-14. 5		1
6-3	30108891	336. 21-09-04	压脚组件14. 5-11-14. 5-11-14. 5		1
6-4	30108893	336. 21-09-05	针夹14. 5-11-14. 5-11-14. 5		1
6-5	30108894	336. 21-09-07	针板14. 5-11-14. 5-11-14. 5		1
6-6	30108895	336. 21-09-08	送料牙14. 5-11-14. 5-11-14. 5		1
6-7	30108896	336. 21-09-09	导线板14. 5-11-14. 5-11-14. 5		1
6-8	30108897	524. 20-09-01	压脚组件14. 5-11-14. 5-11-14. 5		1
6-9	30108915	524. 20-09-11	压脚组件14. 5-11-14. 5-11-14. 5		1
6-10	30108912	524. 20-09-02	三条杠贴条筒进52出17. 5		1

10. 针位零件一览

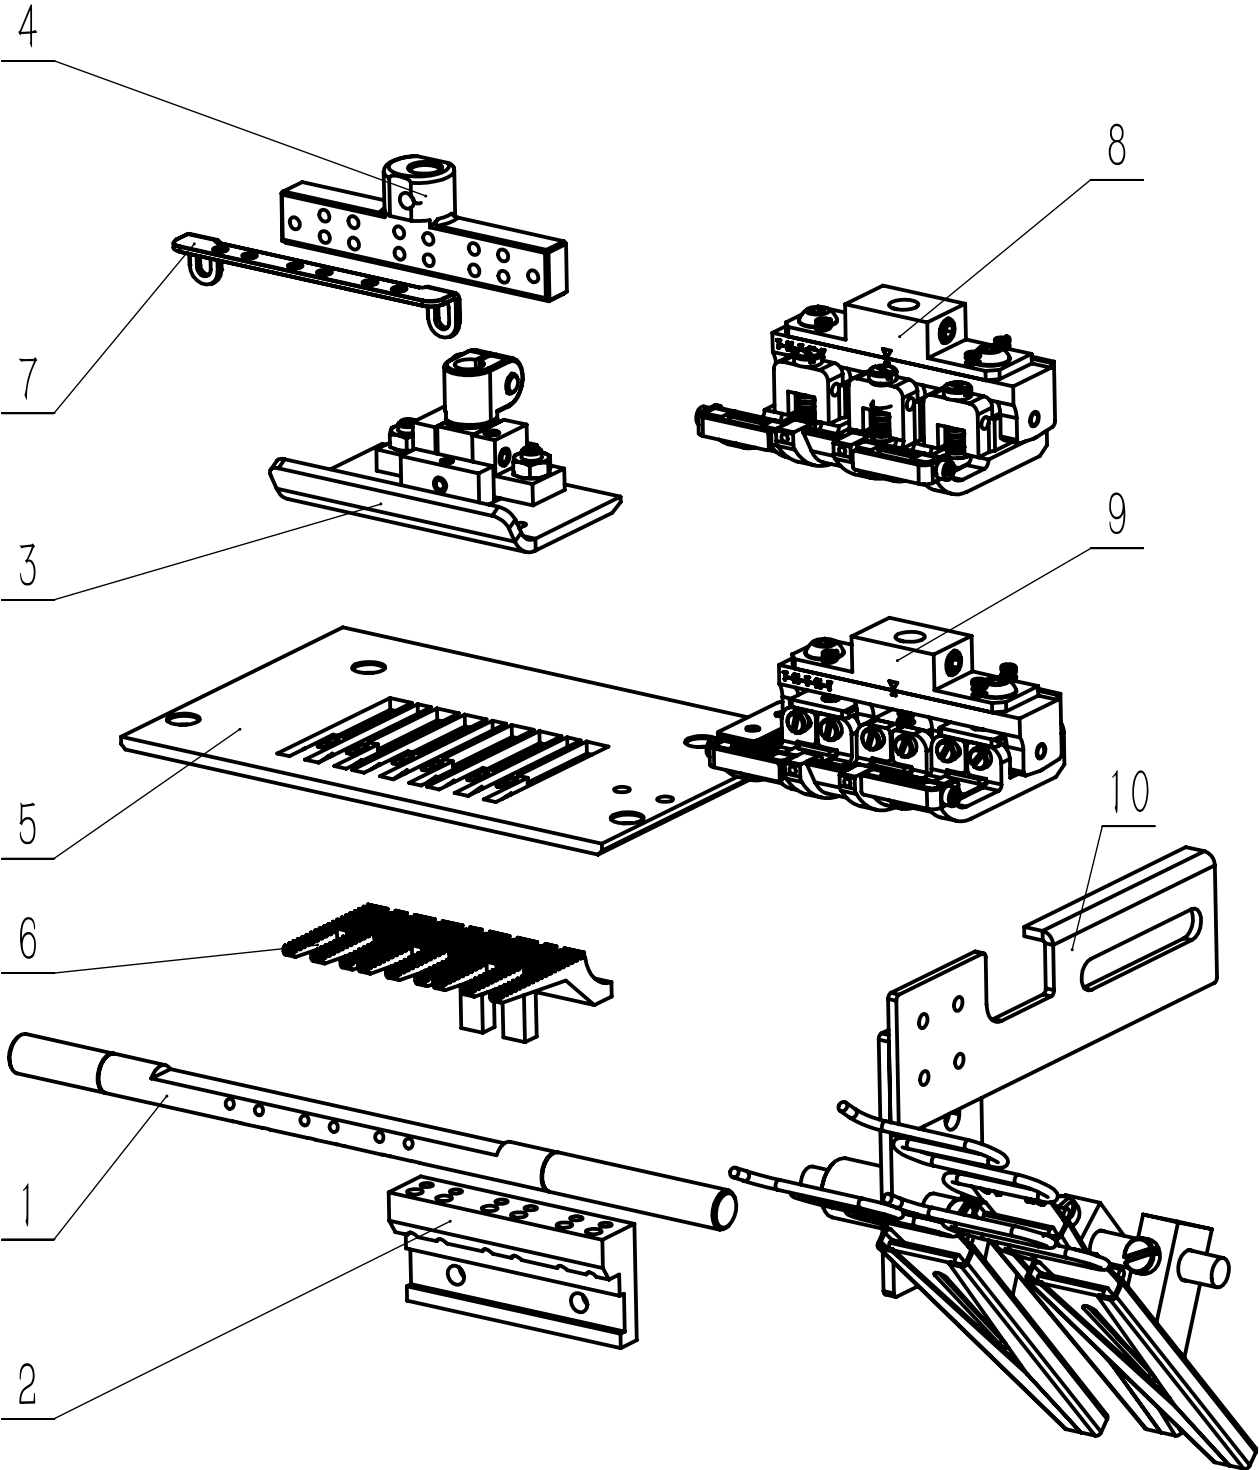

10. 针位零件一览

序号	SAP	图 号	名 称	NAME OF PARTS	数量
7-1	30104115	336. 21-02-01	拨线杆15-12-15-12-15		1
7-2	30104117	336. 21-02-03	弯针座15-12-15-12-15		1
7-3	30104118	336. 21-02-04	压脚组件15-12-15-12-15		1
7-4	30104120	336. 21-02-05	针夹15-12-15-12-15		1
7-5	30104122	336. 21-02-07	针板15-12-15-12-15		1
7-6	30104123	336. 21-02-08	送料牙15-12-15-12-15		1
7-7	30104255	336. 21-02-09	导线板15-13-15-13-15		1
7-8	30109132	524. 20-02-01	压脚组件15-12-15-12-15		1
7-9	30109143	524. 20-02-11	压脚组件15-12-15-12-15		1
7-10	30104430	524. 06-108	贴条筒进40出18		1
8-1	30108743	336. 21-08-01	拨线杆17-12-17-12-17		1
8-2	30108744	336. 21-08-03	弯针座17-12-17-12-17		1
8-3	30108762	336. 21-08-04	压脚组件17-12-17-12-17		1
8-4	30108745	336. 21-08-05	针夹17-12-17-12-17		1
8-5	30108746	336. 21-08-07	针板17-12-17-12-17		1
8-6	30108747	336. 21-08-08	送料牙17-12-17-12-17		1
8-7	30108748	336. 21-08-09	导线板17-12-17-12-17		1
8-8	30108749	524. 20-08-01	压脚组件17-12-17-12-17		1
8-9	30108761	524. 20-08-11	压脚组件17-12-17-12-17		1
8-10	30108817	524. 20-08-02	三条杠贴条筒进58出20		1

11. 附件清单



11. 附件清单

序号	SAP	图 号	名 称	NAME OF PARTS	数量
1	30106399	524. 19-33	短收料安装架		1
2	30057935	524. 11-07	短收料放布板		1
3	30037154	01-505001224-3	内六角圆柱头螺钉M5×12		8
4	30100528	05-053201450-3	平垫片5. 3×2×14. 5		8
5	30033908	07-0521313-6	弹簧垫圈5. 2×1. 3×1. 3		8
6	30048816	01-304000824-3	内六角平圆头螺钉M4×8		3
7	30052483	01-502000624-3	内六角圆柱头螺钉】 M2×6		5
8	30019395	113. 16-19	两用螺丝刀		1
9	30003808	331. 07-10	机针U0×113 GS 14		10
10	30007592	201. 14-05	滤油器		1
11	30007986	201. 22-07-08-10	油漏斗		1
12	30007750	103. 20-50	注油壶组件		1
13	30008052	201. 22-07-08-16	有柄内六角扳手		1
14	30008039	201. 22-07-08-13	镊子		1
15	30007987	201. 22-07-08-11	附件袋		1
16	30043694	REF-IRF-56	反光膜		1
17	30108292	524. 20-01-11	压脚组件7-11-7-11-7		1
18	30019274	21-35001932-4	十字槽半圆头木螺钉ST5. 0×19. 3		6
19	30108530	05-040050600-6	平垫片4×0. 5×6		6
20	30101137	05-040020600-6	平垫片4×0. 2×6		9



富山IoT



微信公众号



抖音官方号

上海富山精密机械科技有限公司

HIKARI (SHANGHAI) PRECISE MACHINERY SCIENCE AND TECHNOLOGY CO., LTD

邮箱/E-mail: hikari@chinahikari.com

网址/Web: www.chinahikari.com

传真/Fax: (00)86-21-67311311

电话/Tel: (00)86-21-67311111 (转外贸部/ext .Foreign Trade Dept)

上海市金山区朱泾镇工业园区中达路800号

NO.800, ZHONGDA ROAD, ZHUJING INDUSTRIAL ZONE,

JINSHAN DISTRICT, SHANGHAI CHINA



QUANTITY ATTESTATION
ISO9001质量体系认证